

Réf.	Modèle
N714	516YC (avec connectique)

MICHAUD

Quickgel

L'étanchéité instantanée



Modèle : 516YC

Instruction montage boîte de raccordement gel avec connecteur

Installation instruction branch gel insulated joint

CE  0,6/1 Kv
Norme EN 50393

	Câble de dérivation			
	mm ²	2,5	4	6
Câble principal	6	●	●	●
	10	●	●	●
	16	●	●	●

Câbles CU 3x à 5x

S'assurer que les règles d'exploitation sont respectées. Cette notice ne concerne que les principales étapes de l'installation du matériel sur des câbles hors tension.

Ce matériel doit être installé par du personnel compétent et familier tant avec l'équipement électrique qu'avec les règles de consignation. Cette notice ne peut en aucun cas se substituer à tout stage, ou expérience relevant des consignes de sécurité.

Make sure that the operating rules are being respected. This Installation Instruction only concerns the main steps of the installation of this product on the de-energized cables.





This product must be installed by a qualified person who shall be acquainted both with the electric equipment and the consigning rules. In any case, this Instruction can't be replaced by any training or experience raising from safety instruction.



SVP, veuillez éliminer tous les déchets conformément aux réglementations environnementales.
Please, dispose of all waste according to environmental regulations.

Quickgel

L'étanchéité instantanée

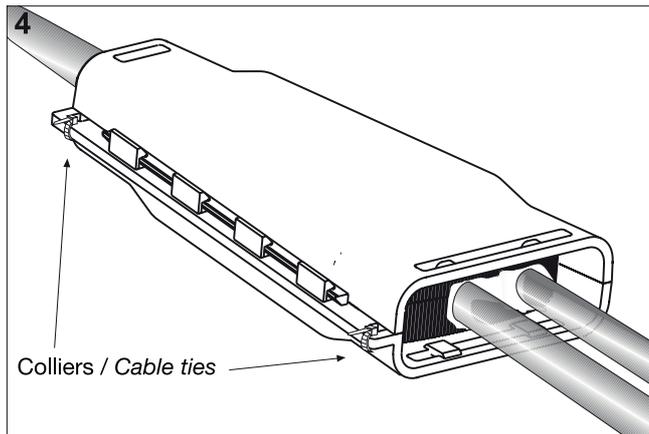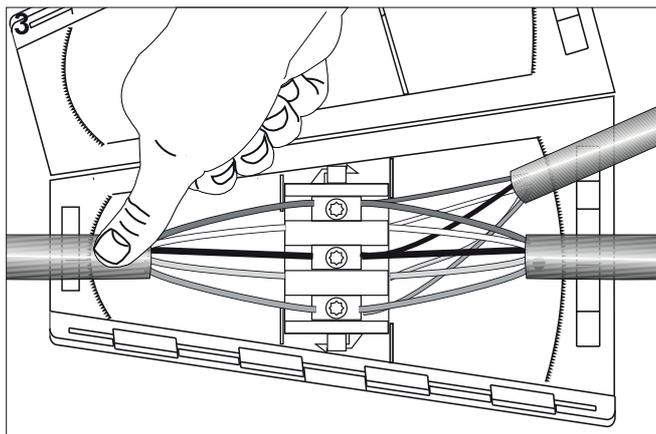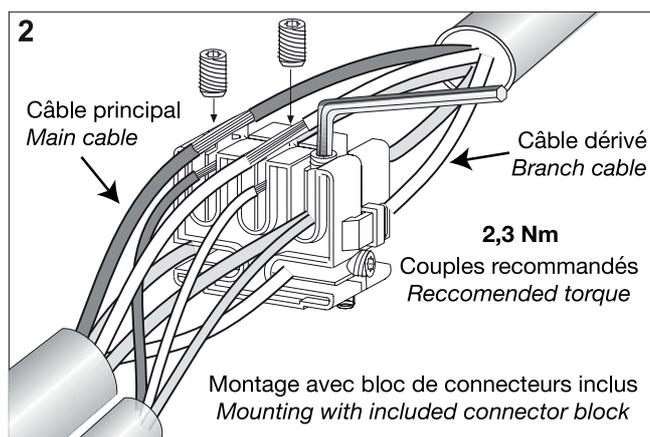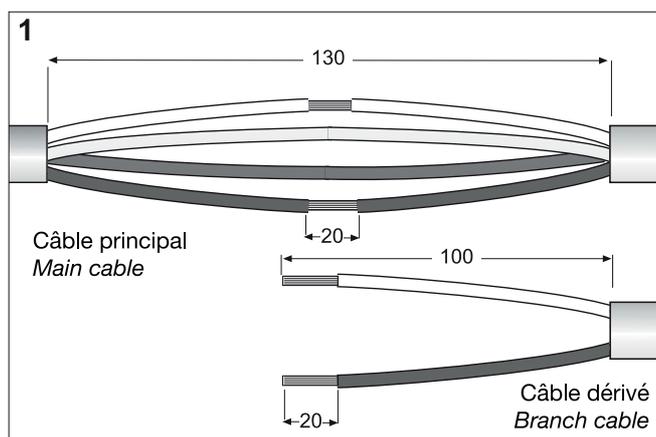

FR

- Fig 1. Retirer la gaine externe du câble principal sur 130mm et la gaine externe du câble dérivé sur 100mm. Dénuder l'isolant des conducteurs sur 20mm.
- Fig 2. Enlever les vis du bloc connecteur et placer les conducteurs du câble principal dans les blocs du connecteur. Mettre les extrémités des conducteurs du câble dans les blocs en bas du connecteur (en dessous du câble principal). Serrer toutes les vis du bloc connecteur avec la clé Allen fournie. (Couples recommandés : 2.3Nm)
- Fig 3. Ouvrir la boîte gel et placer le connecteur à l'endroit prévu à cet effet. Immerger-le dans le gel. Faciliter la rupture des cloisons cassables, en appliquant une pression sur le câble principal et le câble dérivé aux points d'entrée et de sortie.
- Fig 4. Fermer la boîte de raccordement tout en contrôlant que le gel s'échappe au niveau des câbles. Maintenir la fermeture de la boîte de raccordement à l'aide des colliers, inclus dans le kit dans les fentes prévues à cet effet aux extrémités et serrer. (Norme IEC 364).

EN

- Pict 1. Remove the external sheath of the main cable for 130mm and the branch cable for 100mm. Remove the insulation on each core 20mm.
- Pict 2. Remove the screws from the connectors. Open wide the cores of the main cable and insert the connector block positioning each core, also those to not branch, in each connector seat. Put the stripped extremes of the branch cable in the connectors under the corresponding conductors of the main cable. Tighten all the screws of the connector block with the Allen key supplied. (Recommened torque : 2,3Nm)
- Pict 3. Open main and branch cables according to the proper needs and immerse the jointing in the gel positioning the connector in the special seat inside the joint. In order to make easier the breaking of the breakable walls, press the cables on the entry and exit points of the cables.
- Pict 4. Snap-close the jointing-box and check the effective escape of the gel from the extremes of the joint beside the cable. Insert and fasten the cable ties supplied with the kit in the side slits of the joint accordingly. (Standard IEC 364)